

We got some reports that NR board upgrading has problem, some users report the BT menu disappeared after the NR board upgrading, and the NR version is null in the device setting, radio can't enter into the NR board upgrading any more.

The reason is the power supply disconnects during the NR board upgrading, not sure the reason of the power supply disconnection..

Follow the below operation to re-activate the NR board.

1. Update the radio to be V1.05 or afterwards firmware.
2. Press and hold both top key (PF3) and side PF1 key, and power the radio ON.
3. Run the ET25SE_uart_upgrade.exe

Select the com port and check on the box below the comport select frame

Open the D890_NR_BOARD_V112_20260306.ufw firmware

Load the NR firmware to the radio



4. Reboot the radio, the BT menu should be back.