Important Notice: After update the firmware, you need to do the reset to the radio first, power off the radio first. Then power it on while holding the PTT and the PF1 button below the PTT at the same time. The radio will start up with a note on the display stating MCU Reset, Please Wait – and do not turn the radio off while it restarts.

******* See the Separate FW Update Instructions for Details

• Install the Customer Program Software (CPS) by running the D878UVII_CPS_Setup_x.xx.exe setup program in the CPS Program Folder

 After installing a new D878UVII CPS version go to the top Menu -> Tool-> Options in the CPS to set GPS, BT, 500 Hour Record and APRS options as needed

Please make sure the codeplug is saved to PC before your do the update and reset.

*** USB Drivers - Many users have found the D878 radio USB will connect in Windows 10 without loading the AnyTone virtual drivers. The PC found Windows the driver that worked just by plugging in and turning on the radio. If you get a new radio and your PC is Windows10 system, do not install the GD32 virtual driver. *** Just plug the radio USB cable in to the USB port on your PC and let windows find the driver. *** If Windows 10 fails to load a USB driver please see the separate Virtual USB Driver Installation Instructions.

D878UV --- Please use the firmware D878UV_V1.xx for updating the radio. **D878UVII** --- Please use the firmware D878UVII_V2.xx for updating the radio.

D878UVII firmware update V2.04 (dated 2021-12-10)

Change List

- 1. Resolve the issue in V2.03 that radio can't make contact with Repeater.
- 2. Resolve the issue that Talker Alias setting is not saved in export CSV file.
- 3. CPS->Tool-> Channel Talker Alias Operation, allows you check or uncheck all Talker Alias in channel.
- 4. Resolve the issue that CPS->Channel -> Analog APRS Report Freq. is not saved with the selected number.
- 5. Resolve the issue that CPS-> GPS Roaming data is not saved.

Firmware version: V2.04 CPS version: V2.04

SCT 3258 version: V2.01.07 BA (same, no need update)

BT Version: 10033 (same, no need update)

D878UVII firmware update V2.03 (dated 2021-11-30)

Change List

- 1. Allow to select TG and RX group list for the new channel created in radio menu.
- 2. Improve the Single Frequency Repeater unstable problem.
- 3. Add APRS SMS function in the radio menu, allows the radio to receive and transmit APRS message. Sending APRS Text from one AnyTone radio to another that has the APRS Rx feature.

Go to the radio Menu -> APRS -> APRS SMS where you can add a text message using the microphone keys, use the # key to switch from alpha to numbers, etc.

After entering your text, confirm it with the Menu button to get to the next Call Sign / SSID entry screen.

Enter the Call Sign and SSID dash number for the user you want to send the message to; use the # key to switch from alpha to numbers, etc. When you confirm the Call Sign the APRS test message will send.

NOTE: APRS SMS TX setting is using the CPS->APRS-> Analog setting, so the received channel should have the matched frequency setting/CTCSS setting/band width to the TX radio's APRS setting, and have the APRS RX turned on.

- 4. Radio Menu -> Settings -> Device Info, add the APRS board version display
- 5. CPS->APRS->Analog, add 8 groups analog TX frequency. In CPS->Channel->Analog APRS Report Freq, allows select a TX frequency to transmit the analog APRS.
- 6. CPS->Common Setting->Channel ->DMR Mode, add "DCDM TS Split" mode. In this mode, the radio receives on the selected slot in channel, but in transmission it will use the other slot. This configuration is only in use when the radio talk through a D578UV in repeater mode with fixed slot.
- 7. CPS->Common Setting ->GPS Roaming, allow user set a list of GPS locations, when GPS positioning is within the preset radiation radius of coordinates, the radio will switch to the corresponding zone. CPS->Common Setting-> Optional Setting ->GPS/Ranging -> GPS Roaming should be set ON to enable this function(make sure the GPS should be ON first).
- 8. CPS->Common Setting ->Zone -> Zone hide, add Zone Hide function in the Zone menu, it allows user hide some zone when they don't need it on display. Since the Zone Hide is new inserted item, it may be checked automatically when open an existing codeplug. CPS->Tool-> Zone Hide Operation, allows you check or uncheck all Zone Hide.
- 9. Add APRS SMS function in the radio menu, allows the radio to receive and transmit APRS message.
- 10. CPS->Common Setting ->Optional Setting->Key Function, add "Ana APRS Info", for fast accessing the received APRS information.
- 11. CPS->Common Setting ->Channel -> Send Talker Alias, make the Talker Alias to be private setting for each channel, instead of public setting for all channels.
- 12. CPS->Tool -> APRS information Manager, allows the CPS to read the received APRS message from radio and export.
- 13. Add "Draft" in the Messages menu, unsuccessful SMS is saved in draft and can be resent.
- 14. Add timezone GMT+5:30(India), GMT+5:45 (Nepal), GMT+4:30(Afganistan), GMT+3:30(Iran) GMT-3:30 (Newfoundland, Canada), GMT+8:30 (Eucla)
- 15. Change the APRS message to be a lower priority than menu, the radio will not be kicked out of radio menu when receive the APRS message.
- 16. Correct the analog APRS sending inaccurate altitude (height) issue.
- 17. Correct the reverb/echo sound issue when transmit analog in the A+D channel.
- 18. Radio menu -> APRS -> Ana APRS Info ->APRS Verify, allows you set the function on or off. The Anytone firmware has error code verification when receive analog APRS information, it helps to display the data correctly. Turn off the error code verification may improve the analog APRS receive.

Firmware version: V2.03 CPS version: V2.03

SCT 3258 version: V2.01.07 BA (same, no need update)

BT Version: 10033 (same, no need update)

D878UVII firmware update V2.02N (dated 2021-05-31)

Change List

- 1. Correct the issue that FM radio is unable to off in menu.
- 2. Correct the issue that CPS->APRS -> APRS set APRS auto TX intervals(s) doesn't match to radio setting.

Firmware version: V2.01N CPS version: V2.01N

SCT 3258 version: V2.01.07 BA (same, no need update)

BT Version: 10033 (same, no need update)

D878UVII firmware update V2.02 (dated 2021-05-26)

Change List

- 3. CPS->Optional setting ->Display->Date Display Format, allows the user set the date format on display.
- 4. CPS->Optional setting ->Display->Display Channel type, allows the user turn off the channel type on display
- 5. CPS->Optional setting ->Display->Display time slot, allows the user turn off the time slot on display
- 6. CPS->Optional setting ->Display->Display color code, allows the user turn off the color code on display
- 7. CPS-> Optional setting ->Alert Tone, add Ana idle channel tone, the digital channel and analog channel have separated idle channel tone setting.
- 8. CPS->Channel -> Auto scan, tick on the box to allow the radio start scan automatically.
- 9. CPS-> Optional setting -> Volume/Audio, separate mic gain setting for digital channel and analog channel
- 10. CPS-> APRS -> Ana AprsTX, allows to set wide band or narrow band for analog APRS transmit.
- 11. Add the alert tone setting in radio menu.
- 12. CPS->Analog -> 2Tone Setting-> Auto Reset Time changes to maximum 250S. If you set Auto Reset Time to 25s, it keeps the squelch on carrier until there is 25 secs of silence, then it switches back to waiting for tones. If there is a transmission before the end of that 25 secs, the timer restarts. It is useful for the 2Tone Paging System.
- 13. CPS->Analog -> 5Tone Setting-> Auto Reset Time changes to maximum 250S
- 14. CPS->Analog -> DTMF-> Auto Reset Time changes to maximum 250S
- 15. CPS->Channel-> Ana aprs mute, allows to mute the analog APRS audio.
- 16. Digital APRS add Coarse and Speed information.
- 17. Optional Setting ->Other-> Priority Zone A, Priority Zone B change to display the zone name instead of zone number.
- 18. CPS-> APRS-> APRS alt data add "Meters" unit for optional.

Firmware version: V2.02 CPS version: V2.02

SCT 3258 version: V2.01.07 BA

BT Version: 10033

D878UVII firmware update V2.01b (dated 2021-04-10)

Change List

- 19. CPS->Digital -> Contact List, allows to load 500,000 digital contacts.
- 20. Add Analog APRS Receive function (for AT-D878UVII PLUS).

Turn on this function to enable the radio receiving the analog APRS information in current channel. Make sure your channel setting Frequency, CTCSS/DCS match to the transmit radio's setting.

The radio will display the callsign, coordinates, direction, distance, digipeater paths, etc., when receive the analog APRS from the other radios.

Radio Menu-> APRS -> Ana APRS Info, allows to check the receive analog APRS logs.

CPS -> Public->APRS -> Analog APRS -> Receive Allow set to "On", and input the Callsign and SSID you want to receive. The radio will only receive and display the analog APRS information of the filter callsign,

instead of display all analog APRS.

21. We will keep upgrading the firmware to add more Analog APRS function in future.


Firmware version: V2.01b

CPS version: V2.00

SCT 3258 version: V2.01.07 BA

BT Version: 10033

How to know your firmware version

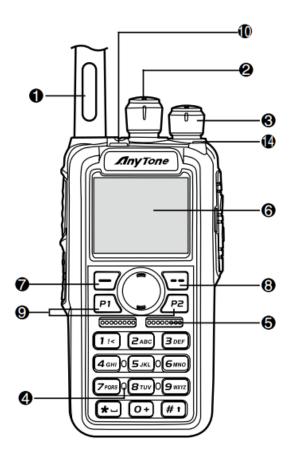

Press 7 (Menu) key to enter the menu, press key to the Device Info and enter into the menu to check the model.

D878UV --- Please use the firmware D878UV_V1.xx for updating the radio.

D878UVII --- Please use the firmware D878UVII_V2.xx for updating the radio.

If you use wrong firmware for updating, the radio will remind "version error". After load into correct firmware, it will work fine.

D878UV Family										
Model Name	Included	Top P3 button	Analog APRS TX	Analog APRS RX	Digital APRS TX	Digital APRS RX	Air band	Memory IC capacity	Digital Contact	Firmware/ CPS
D868UV	GPS	Red	No	No	Yes	No	No	0.5G	200,000	D868UV
D878UV	GPS	Blue	Yes	No	Yes	Yes	No	1G	200,000	D878UV
D878UV PLUS	GPS & BT	Blue	Yes	No	Yes	Yes	No	1G	200,000	D878UV
D878UVII	GPS	Green	Yes	No	Yes	Yes	No	2G	500,000	D878UVII
D878UVII PLUS	GPS & BT	Green	Yes	Yes	Yes	Yes	No	2G	500,000	D878UVII

Notice: D878UVII / D878UVII PLUS has bigger Memory IC capacity with more digital contact, the firmware/CPS is NOT compatible with D878UV.